




ADA TITLE II ASSESSMENT

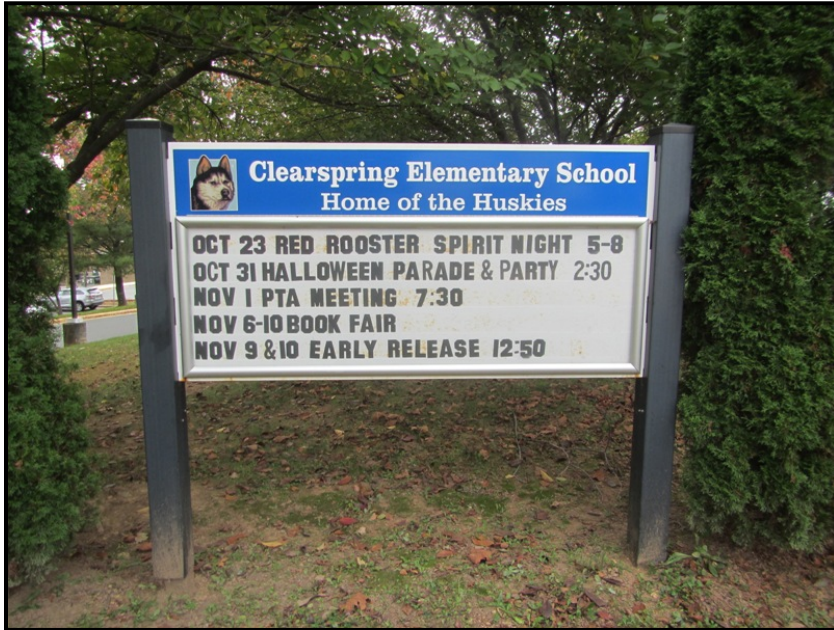

Prepared for:

Montgomery County Public Schools
45 West Gude Drive, Suite 4100
Rockville, Maryland 20850

ADA TITLE II ASSESSMENT

Clearspring Elementary
9930 Moyer Road
Damascus, Maryland 20872

PREPARED BY:

EMG
10461 Mill Run Circle, Suite 1100
Owings Mills, Maryland 21117
800.733.0660
www.EMGcorp.com

EMG CONTACT:

Michael Nelson
Program Manager
800.733.0660 x6244
mnelson@emgcorp.com

EMG Project Number:

123821.17R000-034.303

Date of Report:

October 24, 2019

On Site Date:

October 23, 2017



1 Accessibility

Generally, Title II of the Americans with Disabilities Act (ADA) prohibits discrimination by entities to access and use of the government entity's programs, services, and facilities on the basis of disability. Regardless of their age, these areas and facilities must be maintained and operated to comply with the Americans with Disabilities Act Accessibility Guidelines (ADAAG), and applicable state and local accessibility regulations.

Buildings completed and occupied after January 26, 1992 are required to comply fully with ADAAG. Existing facilities constructed prior to this date are held to the lesser standard of complying to the extent allowed by structural feasibility and the financial resources available, or a reasonable accommodation must be made. The ADA guidelines were clarified and amended in 2010 based on a clarification by the Department of Justice known as the "2011 Site Construction Tolerances Addendum to the 2010 ADA Standards for Accessible Design." The aforementioned document defines the acceptable and allowed construction tolerances above or below the requirements established in the 2010 ADA Standards for barriers related to:

- Accessible Parking
- Pedestrian Path of Travel
- Building Entrances
- Interior Spaces

The scope of the ADA Assessment, as defined in the scope of work, is limited to exterior and interior areas covered by the ADA.

Based on the onsite review, EMG found that barriers to accessibility exist at Clearspring Elementary School. The observed elements were analyzed using the 2010 ADA Standards for Accessible Design and state accessibility codes.

1.1 Accessibility Summary Table

Based on the onsite review, EMG found that barriers to accessibility exist at Clearspring Elementary School. The observed elements were analyzed using the 2010 ADA Standards for Accessible Design and state accessibility codes.

EMG's assessment of the subject property identified the following areas of concern:

Facility / Building	Priority 1 Items	Priority 2 Items	Priority 3 Items	Priority 4 Items	Priority 5 Items	Total Items
Clearspring Elementary School	48	17	24	7		96
Grand Total	48	17	24	7		96

1.2 Barrier Summary Table

The following table summarizes the barriers that were identified. The costs provided are order of magnitude estimates. Costs will vary depending upon the location and volume of work performed. Individual observation details may be found in Appendix A.



Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA
75855	Clearspring Elementary School	BUILDING EXTERIOR	Entrance to Building	Building Entrance-Door	1	The maneuvering clearance at the accessible door is not level and clear.	Entrance Doors - DR3, DR12, DR14, DR15, DR18, DR20 and DR21	ADA
75881	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Stairs	1	Handrail extensions are not compliant.	Interior Stairs - Stairwell A and Stairwell B	ADA
75882	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Ramp	1	Handrails are not continuous or are not at a continuous height above the ramp surface.	Ramp to stage	ADA
75883	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	Adjacent to Main Office	ADA
75886	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Door	1	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	Interior Doors	ADA
75891	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Stairs	1	Handrails are not provided.	Multi Purpose Room - Stage	ADA
75892	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Ramp	1	Handrails do not extend 12" horizontally beyond the top and bottom of ramp runs above the landing surface.	Ramp to stage	ADA
75960	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Door	1	The door has less than 32" clear width.	Kitchen Restroom	ADA
75972	Clearspring Elementary School	BUILDING INTERIOR	Exterior Access Route	Stairs	1	Handrails are not compliant.	Interior Stairs A and B	ADA
76078	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Interior Accessible Route	1	Clear widths are less than 36" minimum, including protruding objects.	Kitchen	ADA
76092	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Ramp	1	The ramp running slope exceeds 1:12 (8.33%).	Ramp to stage	ADA
75846	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Platform Lift	1	A platform lift is required but not provided.	Multi Purpose Room - Stage	ADA
88593	Clearspring Elementary School	BUILDING INTERIOR	Exterior Access Route	Exterior Accessible Route	1	The bus stop boarding and alighting area is not compliant.	Bus loading/unloading zone	ADA
75850	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Loading/Unloading Zone	1	A compliant accessible route is not provided from the passenger loading/unloading zone to the public facility entrance.	Parent loading/unloading zone	ADA
75852	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	The slope of the curb ramp flares is greater than 1:10 (10%).	Curb Ramp CR1	ADA
75853	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	The slope of the curb ramp flares is greater than 1:10 (10%).	Curb Ramp CR4	ADA
75858	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	A curb ramp is not provided where the accessible route crosses a curb.	Parent loading and unloading zone	ADA
75859	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Van	1	MARYLAND: Compliant signage is not provided at the space.	Parking Lot 1 - Stall P1C	State of Maryland
75860	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The access aisle slope is greater than 1:50 (2%).	Parking Lot 1; Access aisle adjacent to accessible space P1A and P1B	ADA
75861	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The slope of the parking space is greater than 1:50 (2%).	Parking Lot 1; Standard accessible space P1A	ADA
75862	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The slope of the parking space is greater than 1:50 (2%).	Parking Lot 1; Standard accessible space P1B	ADA
75863	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The access aisle slope is greater than 1:50 (2%).	Parking Lot 1; Standard accessible aisle adjacent to P1B and P1C	ADA
75893	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible route AR9 adjacent to STR1	ADA



Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA
75958	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	Curb Ramp CR2 Landing	ADA
75959	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	The slope of the curb ramp flares is greater than 1:10 (10%).	Curb Ramp CR3	ADA
76050	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Van	1	MARYLAND: A "Van" space is not provided.	Parking Lot 1	State of Maryland
76057	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The slope of the parking space is greater than 1:50 (2%).	Parking Lot 1; Accessible Space P1C	ADA
76058	Clearspring Elementary School	GENERAL SITEWORK	Accessible Parking	Parking Space-Car	1	The access aisle is less than 60" wide.	Parking Lot 1; Access Aisles adjacent to P1A and P1B and adjacent P1B and P1C	ADA
76095	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Stairs	1	Handrails are not compliant.	Exterior Stair STR1 and STR2	ADA
76111	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Curb Ramp	1	The curb ramp does not meet the slope requirements.	Curb Ramp CR2	ADA
76113	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	Curb Ramps CR3 and CR4	ADA
76203	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Accessible route AR1	ADA
76207	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible route AR2	ADA
76211	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible route AR3	ADA
76215	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible route AR4	ADA
76217	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Accessible route AR6	ADA
76223	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	Ramp R5	ADA
76227	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has cross slopes greater than 1:50 (2%).	Accessible route AR7	ADA
76228	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	Ramp R8	ADA
76231	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	Ramp R10	ADA
76232	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	Accessible route AR11	ADA
76235	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible route AR12	ADA
76238	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible route AR14	ADA
76239	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	Areas adjacent to Ramp R8	ADA
76241	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	Accessible route AR13	ADA
88649	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a rise greater than 6"; however, handrails are not provided.	Ramp R5	ADA
88650	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a rise greater than 6"; however, handrails are not provided.	Ramp R8	ADA
88652	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Ramp	1	The ramp has a rise greater than 6"; however, handrails are not provided.	Ramp R10	ADA

Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA
76090	Clearspring Elementary School	BUILDING EXTERIOR	Exterior Access Route	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	Exterior door buzzers	ADA
75867	Clearspring Elementary School	BUILDING INTERIOR	Common Areas	Vending Machine	2	The vending machines have operable parts which are not within reach range.	Staff Lounge	ADA
75885	Clearspring Elementary School	BUILDING INTERIOR	Locker and Dressing Rooms	Locker and Dressing Rooms	2	The required number of accessible locker and dressing/fitting rooms are not provided.	Gym Office	State of Massachusetts
76081	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	All student spaces throughout the school	ADA
76083	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	All staff spaces throughout the school.	ADA
76088	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Staff Lounge	ADA
76096	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Elevator	2	No characters or numbers are present on the hoist ways.	Elevator Elev-1	ADA
76100	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Door	2	The surface of the door within 10" of the finish floor or ground for the full width of the door on the push side is not smooth.	Corridor fire control doors	ADA
76116	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	Media Center Workroom	ADA
75847	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	All rooms throughout the building	ADA
75864	Clearspring Elementary School	GENERAL SITEWORK	Exterior Access Route	Gate	2	The swinging gate does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the gate.	Playgrounds #2 and #3	ADA
75865	Clearspring Elementary School	GENERAL SITEWORK	Playground	Transfer System	2	The side of the transfer platform used for transfer is obstructed.	Playground #1 and #2 - Transfer Platforms	ADA
75894	Clearspring Elementary School	GENERAL SITEWORK	Playground	Ground Surface-Fibar	2	The ground surface has not been inspected and maintained regularly.	Playgrounds #1, #2 and #3	ADA
76066	Clearspring Elementary School	GENERAL SITEWORK	Soccer Field	Player Seating	2	A wheelchair space is not provided at each player bench for the soccer field.	Soccer Field	ADA
76067	Clearspring Elementary School	GENERAL SITEWORK	Baseball/Softball Field	Player Seating	2	A wheelchair space is not provided at each team bench area at the sports fields.	Softball Field and Soccer Field	ADA
76069	Clearspring Elementary School	GENERAL SITEWORK	Soccer Field	Player Seating	2	A wheelchair space is not provided at each player bench for the soccer field.	Softball Fields	ADA
88594	Clearspring Elementary School	GENERAL SITEWORK	Playground	Play Component	2	The ground level component or elevated component accessed by ramp is required to be on an accessible route but is not within a child's reach range.	Playground #1	ADA
75868	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Lavatory	3	Pipes are not insulated	Staff Restrooms - RR4, RR7, RR8, RR18 and RR19	ADA
75869	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Mirror	3	The bottom of the reflective surface of the mirror is mounted higher than 40".	Staff Restrooms - RR2, RR3, RR4, RR7, RR8, RR13, RR14, RR17, RR18 and RR19	ADA
75870	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	Staff Restrooms - RR3, RR4, RR7 and RR18	ADA
75872	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Mirror	3	The bottom of the reflective surface of the mirror is mounted higher than 40".	Student Restroom - RR1	ADA
75873	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Lavatory	3	The lavatory does not have the required knee clearance.	Student Restrooms - K1, K2, K3 and K4	ADA
75874	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The toilet paper dispenser is not at a compliant location.	Student Restroom - K1, K2 and K4	ADA



Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA
75875	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	Student Restrooms - K2, K4, RR6, RR15	ADA
75876	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Lavatory	3	Pipes are not insulated	Student Restroom - RR5	ADA
75879	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The water closet in a single/user or unisex restroom does not have the required clearance.	Staff Restroom - RR2, RR3, RR4, RR7, RR8, RR13, RR14, RR17, RR18 and RR19	ADA
75887	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Transfer Shower Stall	3	The spray unit does not have a minimum 59" long hose.	Building Services Restroom and Gymnasium	ADA
75888	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Transfer Shower Stall	3	Grab bars are not provided in the transfer shower stall.	Building Services Restroom and Gymnasium	ADA
75889	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Transfer Shower Stall	3	A seat is not provided in the transfer shower stall.	Building Services Restroom and Gymnasium	ADA
75890	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Transfer Shower Stall	3	The curb is more than 1/2" high.	Building Services Restroom and Gymnasium	ADA
75940	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Staff Restrooms - RR2, RR3, RR4, RR7, RR8, RR13, RR14, RR17, RR18 and RR19	ADA
75961	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Signage	3	Means of egress signage is not provided.	All exterior egress doors DR1 to DR21	ADA
76174	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	Student Restrooms - RR5, RR6, RR9, RR10, RR11, RR12, RR15, RR16, RR20 and RR21	ADA
75843	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	Student Restrooms - K1, K2, K3, K4, RR1, RR5, RR6, RR9, RR10, RR11, RR12, RR15, RR16, RR20 and RR21	ADA
75845	Clearspring Elementary School	BUILDING INTERIOR	Common Areas	Assembly Area	3	The assistive listening device is not compliant or is not provided.	Multi Purpose Room	ADA
88589	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	Restrooms - RR7, RR8, RR9, RR10, RR21	ADA
88590	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Toilet Stall	3	The ambulatory stall size is not compliant, or an ambulatory stall is not provided.	Restroom - RR11 and RR12	ADA
88591	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Lavatory	3	The grab bars at the water closet are not present.	Student Restrooms - K1, K2, K3 and K4	ADA
88592	Clearspring Elementary School	BUILDING INTERIOR	Restroom	Restroom/Bathroom-Water Closet	3	The grab bars at the water closet are not present.	Staff Restroom - RR2, RR3, RR4, RR7, RR8, RR13 and RR14	ADA
88647	Clearspring Elementary School	BUILDING INTERIOR	Employee Work Areas	Locker Rooms-Bench	3	The locker room does not have a compliant bench.	Gym Office	ADA
88648	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Elevator	3	A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level.	Elevator Elev-1	ADA



Id	Facility	Building	Assembly	Type	Barrier Priority	Detail	Location Description	ADA
75857	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	The spout of the lower level drinking fountain is located more than 5" from the front edge of the fountain.	Classrooms K1, K2, K3, K4, 1, 2, 3, 5, 7, 9, 10, 11, 12, 13, 14, 15, 18, 19, 20, 21, 22, 23, 24, 25, 26 R1/R2, C, Pre-K R1/R2 and Media Workroom	ADA
75851	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	Drinking Fountain, DF-1, Df-2, DF-3, DF-4, DF-5	ADA
75854	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	Drinking Fountains DF1	ADA
75856	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	Classrooms K1, K2, K3, K4, 1, 2, 3, 5, 7, 9, 10, 11, 12, 13, 14, 15, 18, 19, 20, 21, 22, 23, 24, 25, 26 R1/R2, C, Pre-K R1/R2 and Media Workroom	ADA
88642	Clearspring Elementary School	BUILDING INTERIOR	Kitchen	Refrigerator/Freezer	4	The clear floor space at the refrigerator/freezer is not positioned for a parallel approach to the space dedicated for the refrigerator/freezer with the centerline of the clear floor or ground space offset 24" maximum from the centerline of the dedicated space.	Staff Lounge	ADA
88643	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	Classrooms 4, 8, 16, 17, 27	ADA
88645	Clearspring Elementary School	BUILDING INTERIOR	Interior Access Route	Drinking Fountain/Water Cooler	4	The spout of the lower level drinking fountain is located more than 5" from the front edge of the fountain.	Classrooms 4, 8, 16, 17, 27	ADA